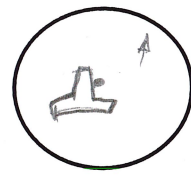


# Vasa båtdelar

Recorded by <i>FELIX /</i>		Date <i>2004-9/1</i>	Del/part <i>KEEL ✓</i>	Fyndnummer <i>00312</i>
Fyndplats/location				
Däck/deck	Sida/side	Balk/beam	Kanonport/gunport	
Material				
Träslag/wood type <i>OAK ✓</i>		Conversion		
Fiberriktning/grain <i>STRAIGHT</i>				
Dimensioner (millimeters)				
Längd/length <i>1145 ✓</i>	Bredd/width <i>max 160 ✓</i>	Tjocklek/thickness <i>max 121 ✓</i>	Diameter (Axle)	
Joinery	<i>Single piece of oak. Carved piece with rabbit cut into it. Scarf at the forward end to meet the stem. All three edges taper towards that end. ✓</i>			
Fastenings	<i>lots of iron nails for garboard. Double clenched on the inside. Two large nails fastening the stem to the keel from the inboard side. ✓</i>			
Coatings				
Skador/damage	<i>Aft end broke off (-&gt; 19150) Surface erosion. Some parts of the joints (rabbit and stem scarf) have still toolmarks visible. Pith of the tree runs along the outside of the piece. ✓</i>			
Reparationer/repairs				
Kommentar/comments	<i>At the joint where the stem meets the keel, there is some caulking left. ✓</i>			
Association		<i>19150 keel ✓ + 00248 stem ✓</i>		