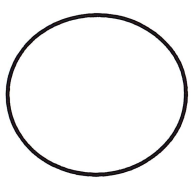


Vasa båtdelar

Recorded by Felix / Fred		Date 2004-08/24	Del/part VINDA PLANK BRÄDA Bordlaggningss-	Fyndnummer 00325
Fyndplats/location				
Däck/deck	Sida/side	Balk/beam	Kanonport/gunport	
Material				
Träslag/wood type PINE / FURU ✓		Conversion More or less carved from central part of log, but not pitte		
Fiberriktning/grain straight				
Dimensioner (millimeters)				
Längd/length 952 ✓	Bredd/width 400 ✓	Tjocklek/thickness Max 28 at center ✓	Diameter (Axle)	
Joinery Carved hood end for wide clinker plank. Flange on hooding end for attachment to stern. Unbeveled outside, upper edge for next plank up. Beveled inside, lower edge for plank below (on keel). Bards and hollow transverse curvature suggest hull flare. Luting core in inside, lower edge but not in flange. Scarf table inside, aft end. Moulding shaped along seams (parallel grooves) - 3 parallel grooves ✓				
Fastenings Plank overlaps fastened with iron nails of flat  section, driven from outside & double-drenched on inside. Hooding end spiked to post with straight nails of same size. Scarf fastened with 1 row of nails along after edge, driven from outside. Nail heads rounded square to round, c. 14 mm across ✓				
Coatings				
Skador/damage A few drips in scarf edge, upper after tip broken off, slight (very slight) surface erosion at scarf. ✓				
Reparationer/repairs				
Kommentar/comments -scarf shows this is bow hooding end on stbd side, seems to be garboard (no notch for a lower hooding end). If so, boat had a flat bottom rather than keel (like storboaten). No real scarf bevel, more gradual thinning. ✓				
Association				