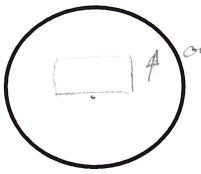
Vasa båtdelar

Recorded by	Date	Del/part	Fyndnummer
FELIX	2004-8/24	VINDA ✓ PLANK	21845

Fyndplats/location

Däck/deck	Sida/side	Balk/beam	Kanonport/gunport

Material

Träslag/wood type	Conversion
? ✓	
Fiberriktning/grain	
straight	

Dimensioner (millimeters)

Längd/length	Bredd/width	Tjocklek/thickness	Diameter (Axle)
1100 ✓	230 ✓	max 23 ✓	

Joinery carved head end for wide dinker plank, double bevle at the lower flange (maybe garboard) notch at top end of flange. Top edge is bevled to take next plank up; no luting cove. Lower edge is mostly broken off. almost 90° turn between flange and scarf table. No molding visible. ✓

Fastenings Plank overlaps + scarf fastened with iron nails. Nails in the overlap are double clenched. Hooding end spiked into stem with bigger sized nails. Two sizes of treenails: Ø12 mm treenail in lower edge, champfer on the outboard side (only half the hole still remains) suggests carved head. Ø8mm treenails in three other places; two close to lower edge. Third in the midde of plank outside the scarf table ✓

Coatings

Skador/damage lower edge is broken off. Some erosion on the surface inside and flange almost no erosion. One scribe line still visible at aft end ✓

Reparationer/repairs second row of nails in the top edge of the overlap are not double clenched ⇒ repair ? ✓

Kommentar/comments

Association